

# Faber Downdraft Transition Guide sheet – Spring 2017

## Buy one of these Downdrafts :



SCLX3015BKNB-B  
SCLX3615BKNB-B  
SCLX3015SSNB-B  
SCLX3615SSNB-B

Use one  
of these  
blowers :

IBDD600-B

RB900 / RB1200  
+  
WIREBOXSCLX  
(**required w/ RB**)

## Buy one of these Downdrafts :



SCIR3014SSNB-B  
SCIR3614SSNB-B

Use one  
of these  
blowers :

IBDD600-B

RB900  
RB1200

### Install Notice

*\*This type of  
install will not be  
available with  
the new  
IBDD600-B*



*\*This is where you removed the  
blower from the box and  
mounted on the front of the  
downdraft to vent thru the back*

\* Do you have questions, or just need more information? If so, turn over or see page 2 \*

## Buy one of these Downdrafts :



SCIR3014SS  
SCIR3614SS

Use one of  
these  
blowers :

IBDD600  
OR  
IBDD600-B with Service Part  
#133.0491.810 Connector 6/9  
Pole

RB900  
RB1200

# Faber Downdraft Transition FAQ's

*If I want to use the new Internal Blower with the previous Scirocco Plus Downdraft what do I do?*

Order the IBDD600-B and the Service Part 9-6 Pole Connector (#133.0491.810)

*What if I have the previous Scirocco Plus installed and I need to replace the blower ?*

If we are out of stock on the previous IBDD600, then order the new IBDD600-B and the Service Part 9 - 6 Pole Connector (#133.0491.810)

*What if I want to use the previous IBDD600 with the new Updated Scirocco Plus Downdraft (-NB) ?*

This is NOT an approved downdraft and blower combination.

*Why did you change to the new model number IBDD600-B ?*

There are two main changes that required us to add the -B.

A change to a 9-Pole Connection from a 6-Pole Connection required to work with the (-B) Downdrafts new control. This will allow for future software updates and was needed to conform with new Energy Regulations. Plus, the blower has new improved fastening mounts to the metal motor box.

*Why did you change the model number on the new Scirocco Plus Downdraft?*

We needed to upgrade our control board to allow for software updates that meet energy regulations. The Control Board was modified to accept these changes and a more reliable electronic transformer. The model number now indicates "NB" aka "No Blower".


*What is the Venting Option that is being discontinued - see page 1 "Install Notice"?*

With the improved blower connection on the new IBDD600-B blower you cannot remove it from the metal attachment box. The previous IBDD600 could be mounted directly to the front of the downdraft and vented backwards thru the unit. This option has been removed.


**All other motor options remain the same.**

*What is this new WIREBOXSCLX accessory listed for the Scirocco Lux?*

This is a new accessory for use with the new Scirocco Lux that is needed to connect the Remote Blower and is required by UL for safety reasons.

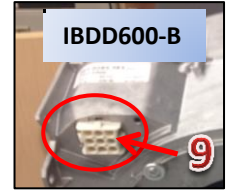

133.0491.810

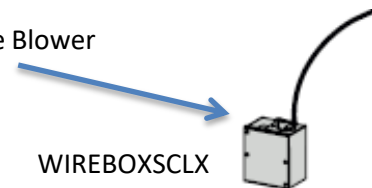

WIREBOXSCLX